

Baby is Reporting Excessive Wrong Positions

Purpose


Possible repair for a Baby that is reporting excessive wrong positions, or not reporting any wrong positions.

Prerequisites

- Baby
- Battery cover key
- Phillips head screwdriver

Steps to Perform

1. Remove the back cover using the instructor key
2. Remove the 2 small Phillips screws, one above and one below the lights
3. You can now pull out the whole module by the green batteries
4. Find the wrong position sensors:

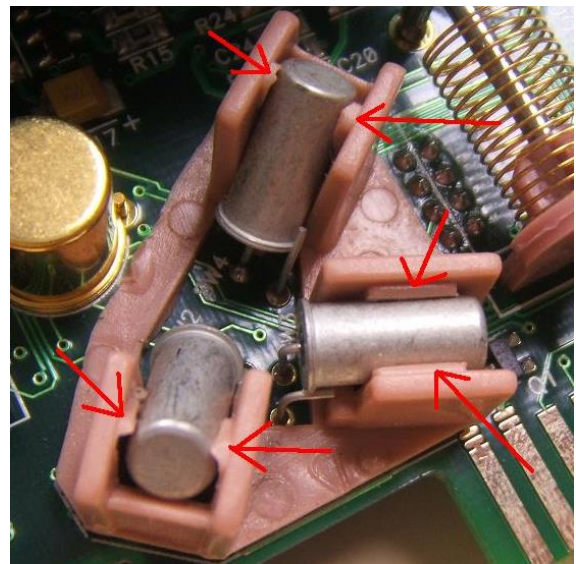

5. Sometimes the cylinders will get out of position. See if you can gently push down the cylinders, especially if one looks too high.
6. GENTLY tap each of the cylinders.
7. Put Baby back together
8. You can test Baby either in a simulation or demo. Contact Product Support if the problem continues.

For additional assistance and video tutorials visit our website:

www.realityworks.com/support/